


# DAY & NIGHT COLOR CAMERA

MODEL # CC5301



## Camera Features:

- SONY 1/3" Super HAD Color CCD
- Resolution Horizontal 480 TV Lines
- Auto UV Filter
- Super Low Light Sensitivity  
Color : 0.5Lux, B/W : 0.03 Lux
- DC/Video/ESC IRIS Mode
- On Screen Display
- Motion Detection
- Remote Control Ready VIA RS-232C
- AC24V/DC12V Dual Power Source

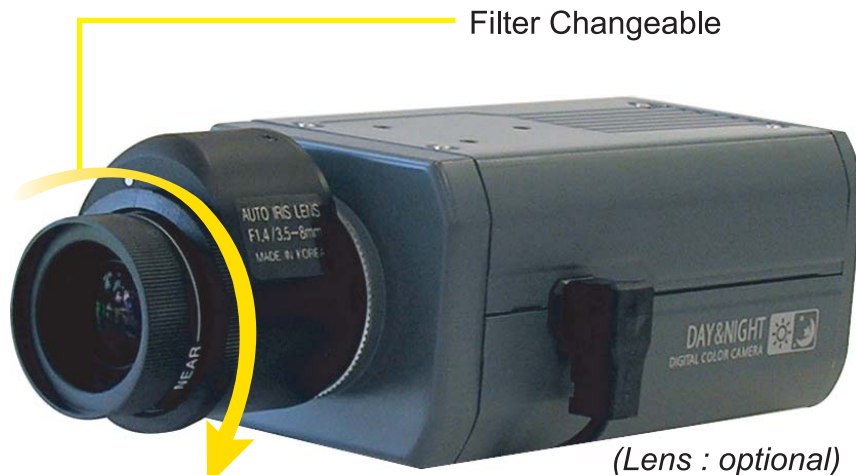

### • Installing C/CS Mount Lens

Before mounting a lens, please check whether it is a C-mount or CS-mount lens. The back focus for the CS-mount lens at the factory.

### • Mounting a CS-Mount Lens

After removing the protecting cap, attach the lens onto the camera by turning it clockwise.




WAREHOUSE



GROCERY



STORE

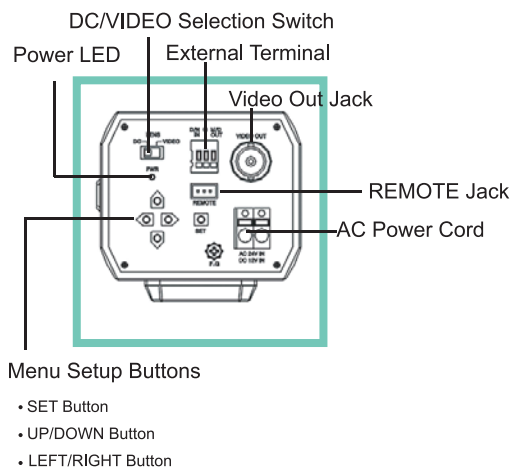

**CLOVER**  
ELECTRONICS USA

[www.cloverusa.com](http://www.cloverusa.com)


T: 562-282-5700

F: 562-282-5800


877-327-5000 (Toll Free)

13073 E. 166th St. Cerritos, CA 90703

# Day & Night Color Camera

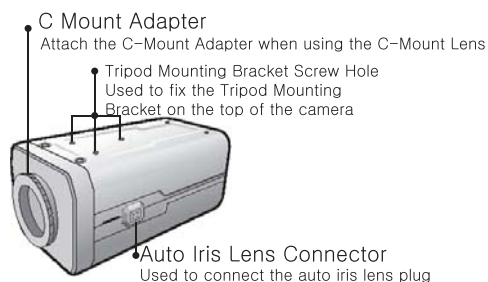


Front View

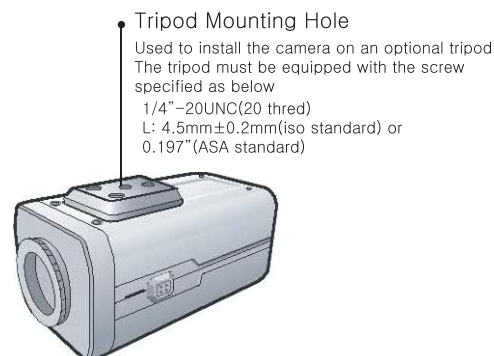

Bottom View

## DIMENSIONS:

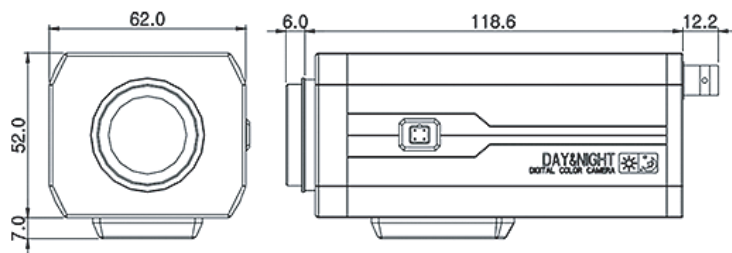

## SPECIFICATIONS:

	NTSC	PAL
Image Sensor	1/3" SONY SUPER HAD IT CCD	1/3" SONY SUPER HAD IT CCD
Picture Elements	811(H)x508(V)	795(H) 596(V)
Effective Pixels	768(H)x494(V)	752(H) 582(V)
Scanning System	2:1 Interlace(NTSC Standard)	2:1 Interlace(PAL Standard)
Resolution	525 Line / 60Fields / 30Frames	625 Line / 50Fields / 25Frames
Shutter Speed	480(Color) / 520(BW)	TV Lines Horizontally
S/N Ratio	1/60~1/10,000sec	1/50~1/10,000sec
Video Output	More than 48dB (AGC OFF)	1.0 Vp-p PAL composite
Min. Illumination	1.0 Vp-p NTSC composite	0.5Lux at F1.2(Color)
	0.5Lux at F1.2(Color)	0.01Lux at F1.2(B/W)
	0.03Lux at F1.2(B/W)	
Sync. System	Internal / Line Lock selectable	
Back Light	ON/OFF selectable	
Iris Mode	DC Iris / Video Iris / ESC selectable	
White Balance	ATW / AWC / MANUAL selectable	
Lens Mount	CS-mount(or C-mount with the supplied adaptor)	
Color	AUTO / ON / BW / EXT.selectable	
O.S.D	Built-in	
RS-232C comm.	Available	
Power Supply	AC 24V, 60Hz / DC 12V (Non Polarity)	
Power Consumption	MAX. 4.0watt.	
Operating Temperature	-10 ~ +50	
Operating Humidity	90% RH Max.	
Dimension	62(W) 52(H) 133(L)mm (Without Lens)	



For More Information,  
Call Toll Free 877-327-5000

[www.cloverusa.com](http://www.cloverusa.com)